

AF15.12-P-6400EA	Engine hard to start, long starting time and/or dies again	1.9.92
------------------	--	--------

ENGINE 119.97 in MODEL 124, 129, 140

ENGINE 119.96 in MODEL 129

Modification notes

26.8.98	Validities changed		
---------	--------------------	--	--

Damage code	Cause	Remedy:	
15 318 38	Interval between crankshaft position sensor (L5) and segment on flywheel too low. Fault code readout Usually no DTC stored.	1 Remove/install crankshaft position sensor. LH injection → KE injection →	AR15.12-P-2133E ra15001192133x
		2 Install 0.5 mm thick shim between crankshaft position sensor (L5) and support. Note Fabricate 0.5 mm thick shim (e.g. from gasket paper) in shop.	