

09 Turbocharger, Air Cleaner

Complaint:

Oil leak at gasket between boost air distribution pipe and cylinder head

Engines 602.96, 603.96

Cause

Gasket between boost air distribution pipe and cylinder head.

Remedy

Install modified gasket.

Notes

A slight leakage of oil (sweating) corresponds to the normal condition and is not a problem. Replacing the turbocharger does not offer any remedy.

If oil leakage is severe, see AF01.30-4040AU

Part	Part no.
Gasket (engine 602.96)	602 141 02 80 05
Gasket (engine 603.96)	603 141 02 80 05
