


K17

AP13.22-P-1351-01A


Poly V-belt damage patterns

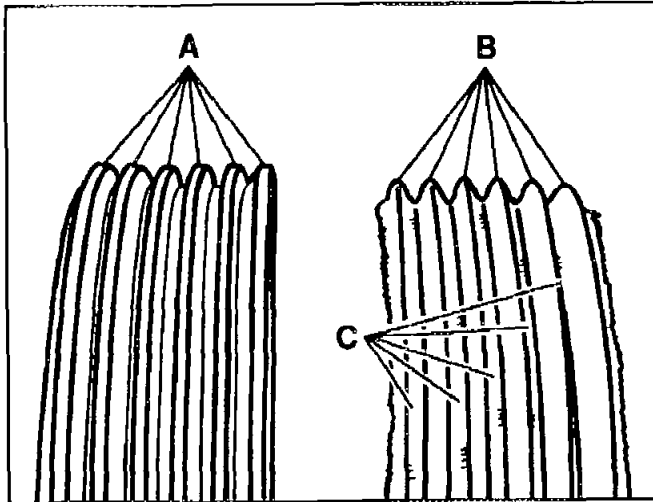


N13.22-2068-01

Edge wear - wedge shaped ribs (B) and backing cord visible at bottom of grooves (C), in new condition the ribs have a trapezoidal shape (A)

Lateral cracks on back (D)
Lateral cracks across a number of ribs (E)

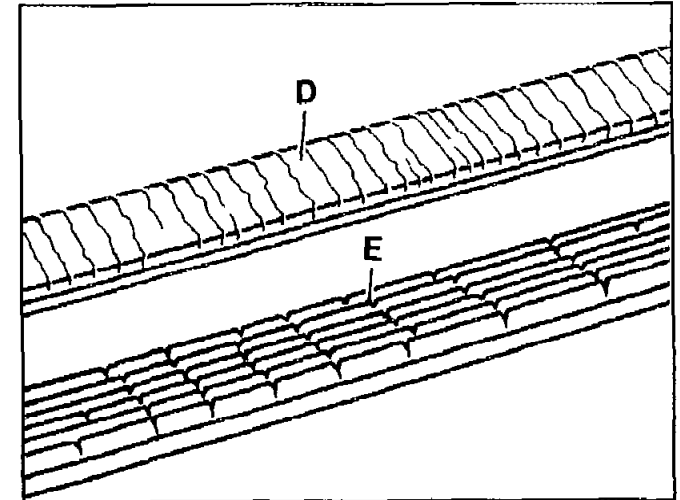


N13.22-2066-01

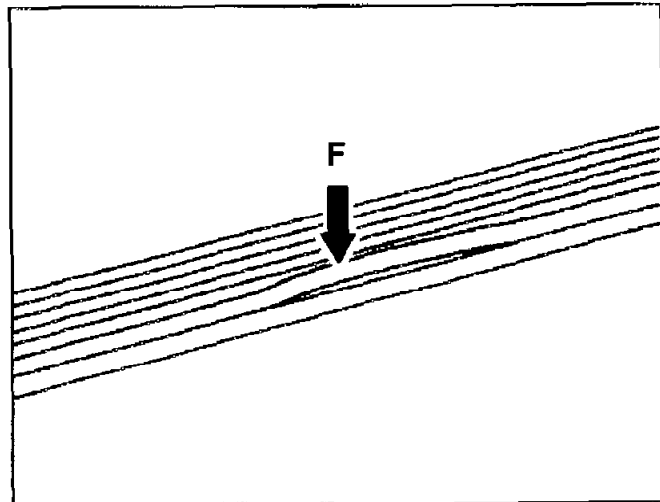


N13.22-2071-01

Ribs torn off of belt (F)

Belt cord pulled out at side (G), outer belt cords frayed (H)

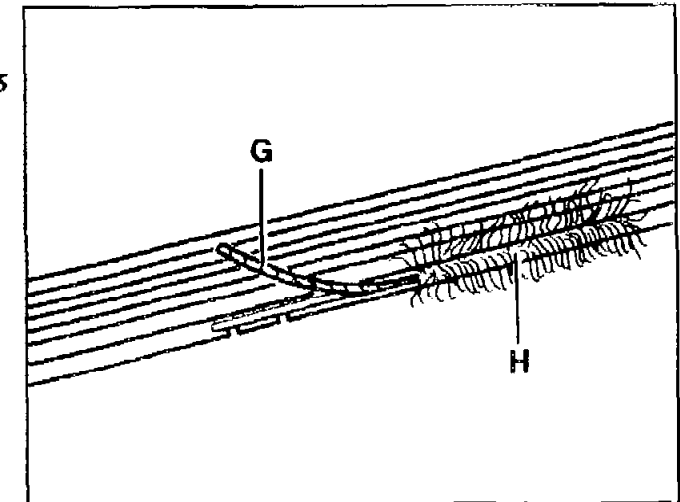


N13.22-2067-01

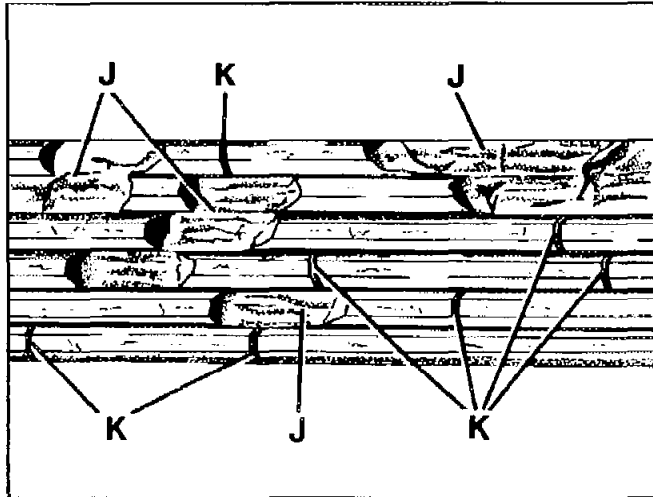

Chunks broken out of ribs (J)
Lateral cracks in ribs (K)

N13.22-2069-01

Chunks of rubber at bottom of grooves (L),
contamination or stones stuck in grooves (M)

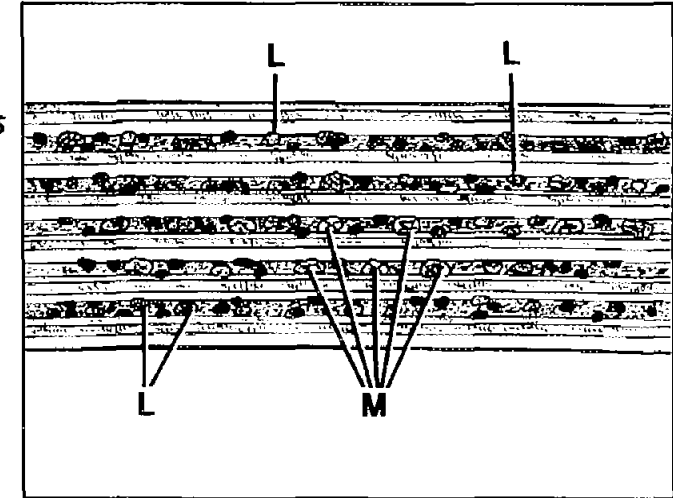

N13.22-2070-01