


14-1791 Removing and installing resonance flap of intake manifold

Preceding work:
Removing and installing resonance intake manifold
(14-1961).

Operation no. of operation texts and work units or standard texts
and flat rates:
14-1791

Engine 606.910

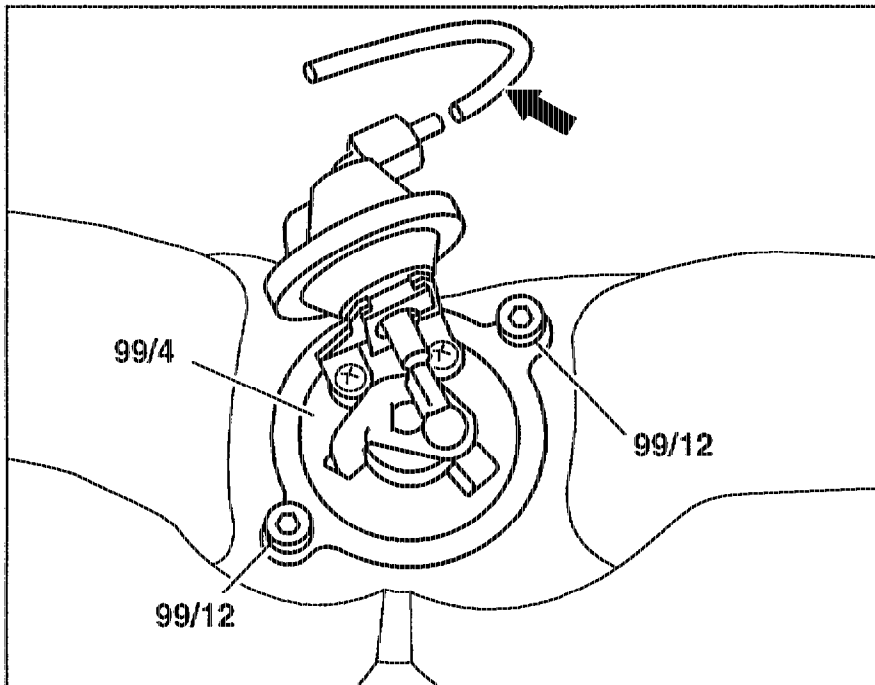

P14-5142-35

Vacuum line (arrow)	detach, fit on.
Bolts (99/12)	unscrew, screw in.
Resonance flap of intake manifold (99/4)	remove, examine O-ring, replace if necessary, insert.



Resonance flap must **not** be operated by
hand. For testing, pressurize vacuum unit with
vacuum.